J. H. Saltzer

For your into

Honeywell

RECEIVED

NOV 3 0 1973

J. H. SALTZER

CT Clingen

JW Gintell RE Hoffman

Attendees

Subject:

FORUM Minutes for 20 November 1973

Attendees:

To:

WJ Burner RJ Chevalier DA Kayden ED Kleinow LJ Ryan

JR Steinberg

RC Dalev

RA Roach

HARDWARE. ED Kleinow

--Status of Priority 1 problems --

MVN does not work in a consistent manner. Fix known; scheduled to be installed by 25 November 1973.

CSL instruction gets op-not-completes. No new data on this one. FED investigating.

#50 CSL instruction sometimes ignores PR modification for operand 2. (CPU-B) No fix yet; Webber working on it.

#48 CMPN instruction sometimes fails with large exponents. Fix known; will be installed by 25 November 1973.

-- Processors --

'Installation of FCO's during the coming week will bring both processors up to the current revision level.

·Four crashes during the past week were due to clock reading problems. FED installed fix on Saturday, 17 November 1973.

-- CSM5 - Stack failure last week. FED replaced it and ran okay.

--DIA-Development - Down for 7 hours last week. Chip failure on JM board located and replaced.

--355-Development - BA board failed. Received another BA board and installed; eventually removed this board and moved it to Service 355.

-- Mem C-Store B - Power fault occurred last week. Problem corrected. Parity errors also occurred last week (Mem A); FED checked it out but couldn't find hard failure.

-- PRT-301 - Down 11 hours on Friday. Slip collar mechanism binding on shaft. Problem corrected.

--DSS190 - Area 4 down on Monday night. Possibility of bad disk pack. FED investigating.

- -- Card Reader Card Read Alerts Optic assembly ordered.
- --Mag Tape Drive "D" Drive drops into check status for no apparent reason. FED investigating
- --MTS-500 MPC had two bad memory chips; FED replaced and it checked out okay.
- --Punch Lost several jobs last week because of mechanical failure. FED working on problem.

SOFTWARE, RA Roach

- --Three crashes during past week -
 - ·2 CPU Bug in PXSS fixed in release 21.3a.
 - ·'Mylock' bug in find.
 - ·Bug in IMP changes in release 21.3.
- --ARDS problem (Bug #157) continues to cause serious service problems. IPC requests a status on this problem.

HARDWARE TO BE INSTALLED

- --190 Dual Channel necessary cables expected to arrive by end of November.
- --MTH500 dual channel expected by 30 November 1973; installation to follow.
- --Additional 190 shipment of the device is in hold status.
 Will reschedule after discussion with Wes Burner.

OTHER

--Dick Steinberg noted dismay and dissatisfaction at the extremely long time for resupply of parts, i.e., Tuesday a. m. until Thursday p. m. for critical board replacement.